

Vaisala - How to integrate the Vaisala WXT520 with the Topcon NET-G3

526 Beth Bartel January 26, 2010 [Vaisala](#) 2464

Integrating the Vaisala WXT520 with the Topcon NET-G3



Equipment needed

- Vaisala WXT520 Met-Pack
- WXT520 serial cable
- 9V battery
- NET-G3 receiver

Software Needed

- PC-CDU Version 7.12 (Build: Dec. 21, 2007) ([.zip](#))
- Vaisala Configuration Tool Version 2.01 r. 9 (see link below)

Configuring the Vaisala WXT520

We first describe how to configure the WXT520 to output a single XDR NMEA v3.0 0183 message containing the following values: Pressure, Temperature, Humidity, Wind Speed, Wind Direction, Rain Accumulation & Hail Accumulation. The reason we choose an XDR NMEA v3.0 0183 message is because this is the only type of met message the Topcon NET-G3 can receive.

One way to configure the WXT520 is using the Vaisala Configuration Tool. The latest version at the

time of writing this is Ver. 2.01 r.9; it can be downloaded at <http://www.vaisala.com/services/software.html>.

Connect the WXT520 to a Windows computer and start up the Configuration Tool. If you don't see any readings coming then you will have to go into Configuration Setup via File → Configuration Setup. The following window will appear:



Figure 1: COM port settings for communicating with a WXT520 using the Vaisala Configuration Tool.

Confirm the settings above and click OK. In the main window you should now see some values being read by the Configuration Tool from WXT520.

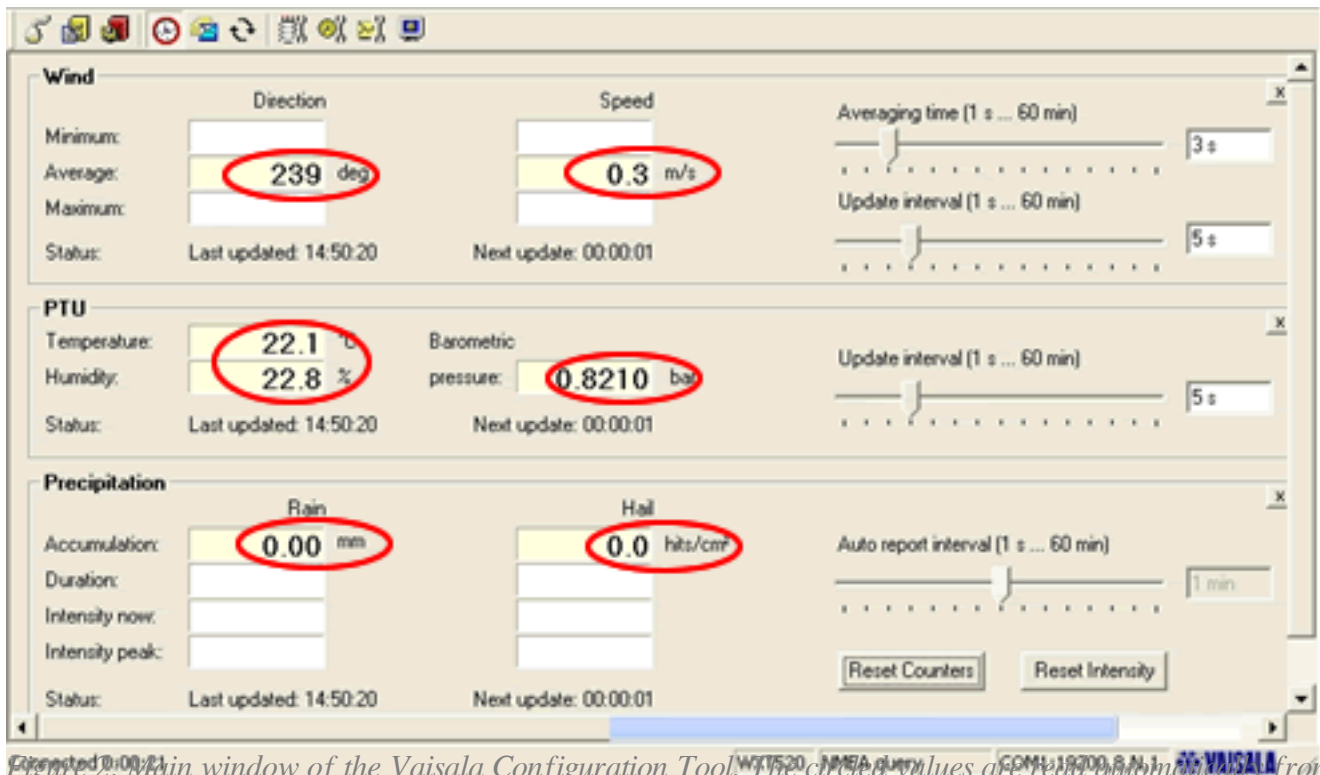


Figure 2: Main window of the Vaisala Configuration Tool. The circled values are read automatically from the WXT520 if it is set up to output Wind, PTU and Precipitation.

Now that the Vaisala Configuration Tool is communicating with the WXT520 we can start setting it up to output the XDR NMEA v3.0 0189 message.

From the Settings drop-down menu select “Device...” The following window will appear; check that the settings are as they are shown here:

Device			
Model:	WXT520	Serial number:	E3240001
Version:	2.14	PTU sn:	E3120014
Calibration date:	6.8.2009	Order code:	AAB0BA10B
Info:	<input type="text" value="N"/>	Address:	<input type="text" value="0"/>

Enhancements	
<input type="checkbox"/> Enable heating	Supervision interval (1 s ... 60 min)
<input type="checkbox"/> Error messaging	<input type="text" value="60 min"/>
<input checked="" type="checkbox"/> Composite message auto transmission	Auto composite interval (1 s ... 60 min)
	<input type="text" value="5"/>

Communication protocol	User port settings
<input type="radio"/> SDI-12 v1.3 <input type="checkbox"/> Continuous measurements	Port type: <input type="text" value="RS-232"/>
<input checked="" type="radio"/> NMEA v3.0 <input checked="" type="checkbox"/> Query only <input checked="" type="checkbox"/> Use XDR for wind message	Bits per second: <input type="text" value="19200"/>
<input type="radio"/> ASCII auto <input type="checkbox"/> Polling only <input type="checkbox"/> Response with CRC	Data bits: <input type="text" value="8"/>
	Parity: <input type="text" value="None"/>
	Stop bits: <input type="text" value="1"/>
	RS-485 line delay (ms): <input type="text" value="25"/>

Figure 3: The Device Configuration window for the WXT520. The key settings in this window are the “Composite Message auto transmission” checkbox and the “Auto Composite interval”. Set the interval to what you need it to be. The next key setting in this window is the “Communication protocol”. Be sure to select “NMEA v3.0” and check the “Query Only” and the “Use XDR for wind message”.

Note that we have checked the “Query Only” box in the Communication Protocol section. This is so that Wind, PTU and Precipitation data don’t come through unless the WXT520 is queried for them. Also note that we check “Composite message auto transmission” so the composite message will automatically be output but the individual Wind, PTU and Precipitation will not. This is crucial. After you are done click

OK.

We now configure the Wind, PTU and Precipitation sensors within the WXT520. From the Settings drop-down menu select “Sensors...” You will get the following window. Check that the settings are as they are shown here:

Wind

Gust averaging:

Speed unit:

Sampling frequency:

Direction correction (°):

Averaging time (1 s ... 60 min):

Update interval (1 s ... 60 min):

PTU

Temperature unit:

Barometric pressure unit:

Update interval (1 s ... 60 min):

Precipitation

Counter reset:

Rain unit:

Hail unit:

Rain overflow reset (1.00 ... 655.35 mm):

Hail overflow reset (10.0 ... 6553.5 hits/mm²):

Auto report interval (1 s ... 60 min):

Auto report based on:

Figure 4: WXT520 sensor settings. The main things to change here are the PTU “Temperature Unit” and the “Barometric pressure unit”.

Now we move on to the final step in configuring this WXT520, the Message Settings. From the Settings drop-down menu select “Messages...” The following window will appear. Check that the settings are as they are shown here:

Wind message <input type="checkbox"/> Direction minimum <input type="checkbox"/> Speed minimum <input checked="" type="checkbox"/> Direction average <input checked="" type="checkbox"/> Speed average <input type="checkbox"/> Direction maximum <input type="checkbox"/> Speed maximum	Composite message <input type="checkbox"/> Direction minimum <input type="checkbox"/> Speed minimum <input checked="" type="checkbox"/> Direction average <input checked="" type="checkbox"/> Speed average <input type="checkbox"/> Direction maximum <input type="checkbox"/> Speed maximum <input checked="" type="checkbox"/> Barometric pressure <input type="checkbox"/> Pressure ref. temp <input checked="" type="checkbox"/> Air temperature <input checked="" type="checkbox"/> Relative humidity <input checked="" type="checkbox"/> Rain accumulation <input checked="" type="checkbox"/> Hail accumulation <input type="checkbox"/> Rain duration <input type="checkbox"/> Hail duration <input type="checkbox"/> Rain intensity <input type="checkbox"/> Hail intensity <input type="checkbox"/> Rain peak <input type="checkbox"/> Hail peak <input type="checkbox"/> Heating temp. <input type="checkbox"/> 3.5 V reference <input type="checkbox"/> Heating voltage <input type="checkbox"/> Info <input type="checkbox"/> Supply voltage
PTU message <input checked="" type="checkbox"/> Barometric pressure <input type="checkbox"/> Pressure ref. temp <input checked="" type="checkbox"/> Air temperature <input checked="" type="checkbox"/> Relative humidity	
Precipitation message <input checked="" type="checkbox"/> Rain accumulation <input checked="" type="checkbox"/> Hail accumulation <input type="checkbox"/> Rain duration <input type="checkbox"/> Hail duration <input type="checkbox"/> Rain intensity <input type="checkbox"/> Hail intensity <input type="checkbox"/> Rain peak <input type="checkbox"/> Hail peak	
Self diagnostic <input type="checkbox"/> Heating temp. <input type="checkbox"/> 3.5 V reference <input type="checkbox"/> Heating voltage <input type="checkbox"/> Info <input type="checkbox"/> Supply voltage	

Figure 5: The Wind, PTU and Precipitation message boxes are the values that are queried by the Vaisala Configuration Tool as in Figure 2. The values under the Composite Message Section are the values that will be output to and combined with the GPS .tps files being recorded on the Topcon NET-G3.

The WXT520 met-pack is now configured to output messages that look like:

```
$WIXDR,A,282,D,1,S,0.1,M,1,C,22.0,C,0,H,23.0,P,0,P,0.8211,B,0,V,0.00,M,0,V,0.0,M,1*42
```

This message will be read by the Topcon NET-G3 and injected into .tps files being recorded on the GPS receiver.

In order to check that these messages are being output at the specified rate, connect to the WXT520 via hyperterminal. Below are the settings you need to set in the hyperterminal. From within hyperterminal,

click the drop-down menu File and select “Properties”.

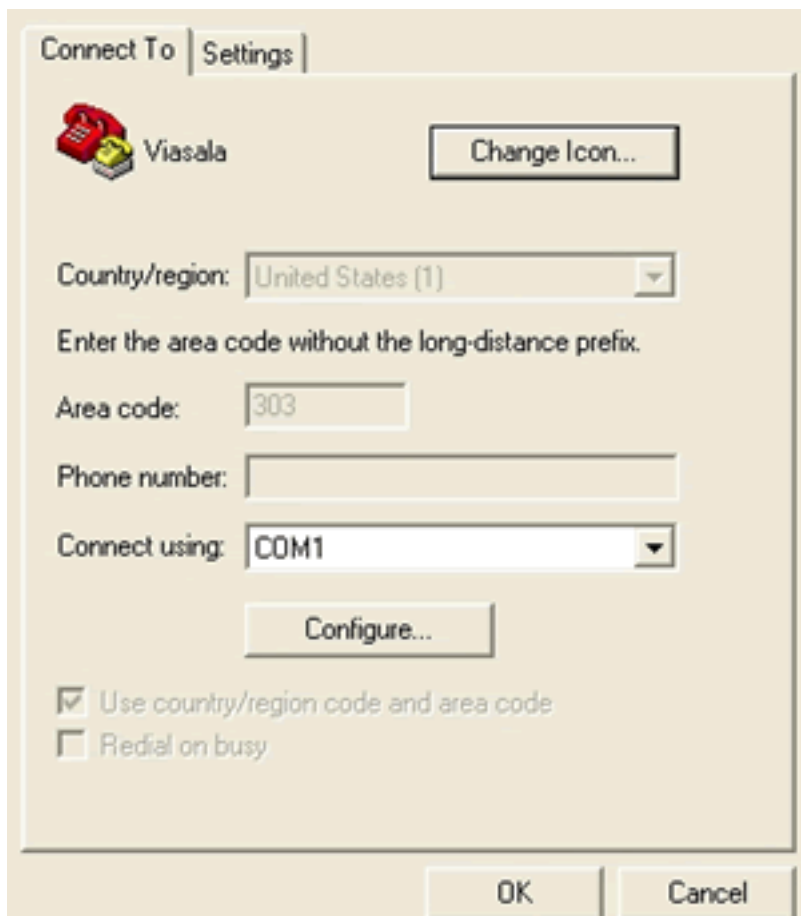


Figure 6: Beginning menu to configure a hyperterminal to communicate with the WXT520.

From here click on the “Settings” tab at the top. The following window will appear. Check that the settings are as they are shown here:

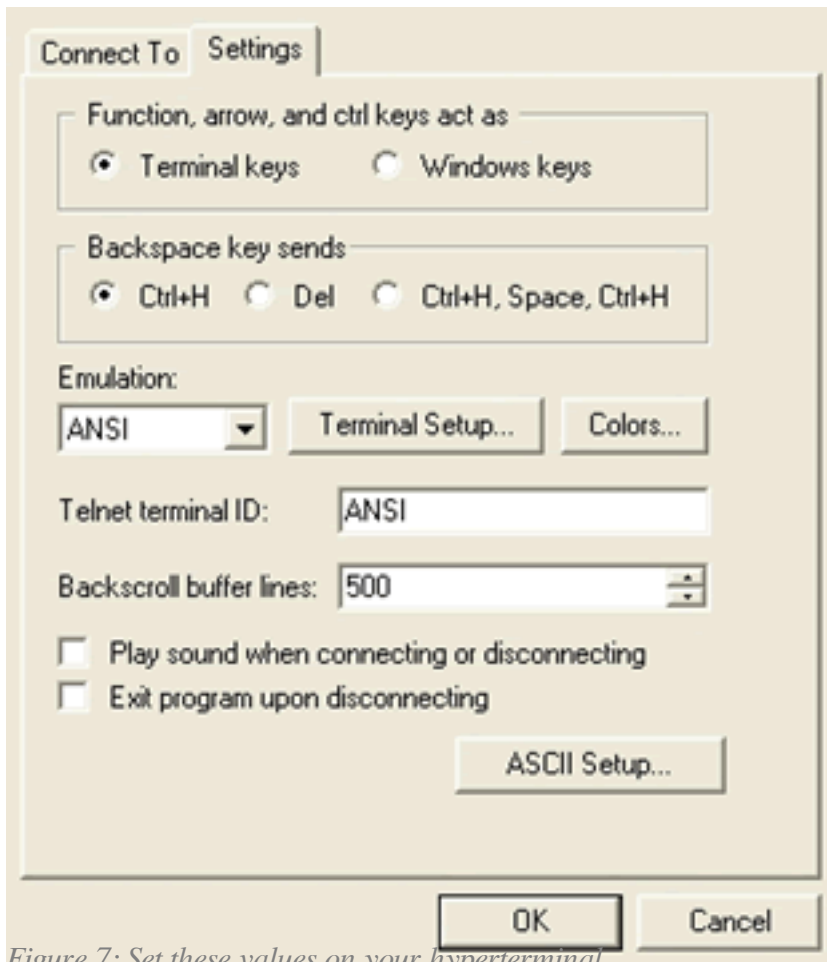


Figure 7: Set these values on your hyperterminal.

From this window click on “ASCII Setup...” to get the following menu. Check that the settings are as they are shown here:

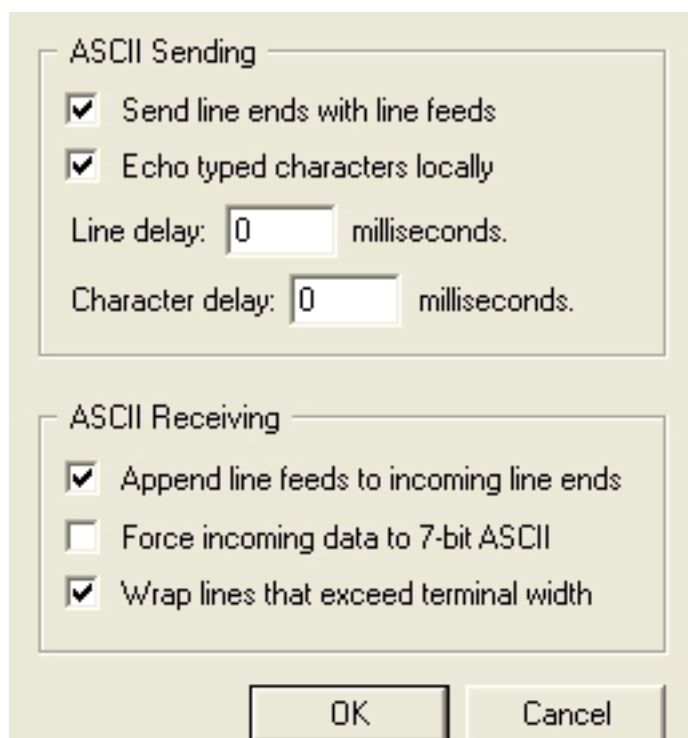


Figure 8: These settings will allow you to send commands to the WXT520 via hyperterminal.

Now that all of this is set, click OK until you get back to the main hyperterminal menu. You are now ready to connect to the WXT520. Once you connect you will start seeing the Composite Message come through to the terminal.

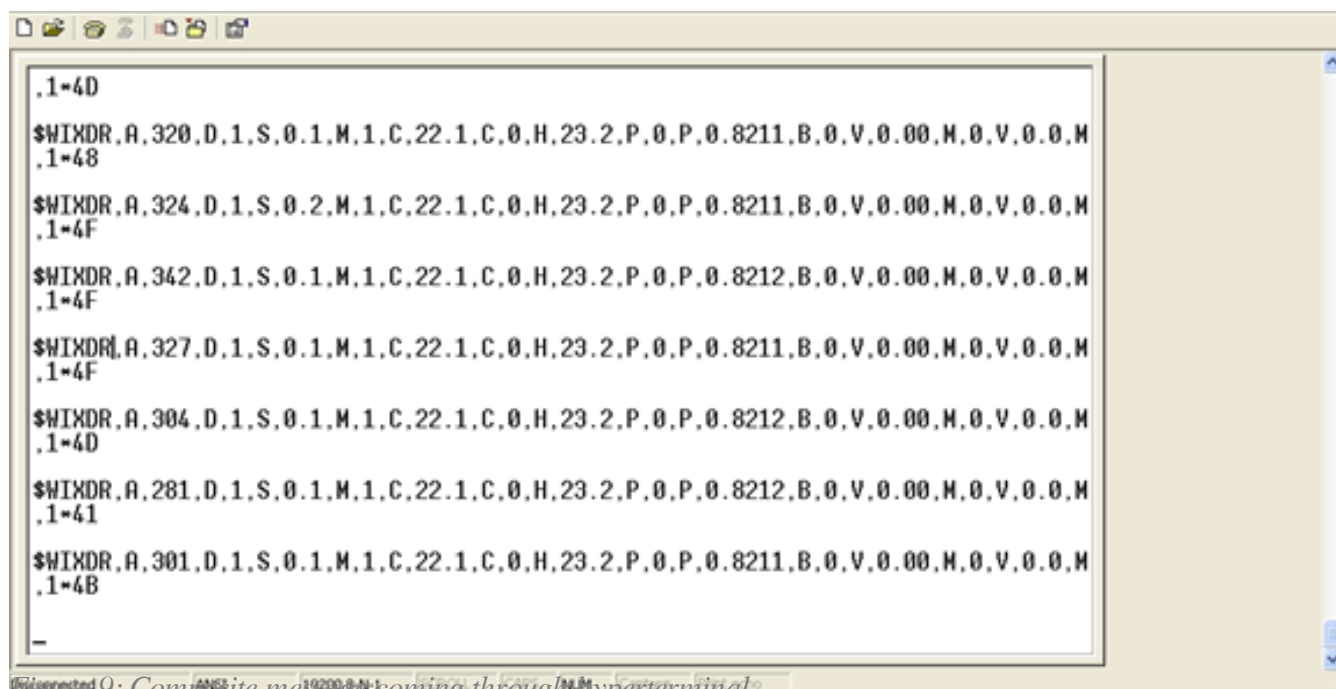


Figure 9: Composite message coming through hyperterminal.

Configuring the NET-G3

Connect the DB9-Fisher RS232 cable that comes with the Topcon receiver to a serial port on your

computer and to the front of the NET-G3. Start PC-CDU and connect to the receiver. From the Configuration drop-down menu, select Receiver. The configuration window will appear; select the Ports tab at the top and set the serial port as shown here:

The screenshot shows the 'Ports' configuration window in PC-CDU. The 'Serial' tab is selected. There are four serial port configurations: Serial A, Serial B, Serial C, and Serial D. Serial A has Input: Command, Output: None, Baud rate: 115200, and Period (s): empty. Serial B has Input: None, Output: None, Baud rate: 115200, and Period (s): empty. Serial C has Input: Echo, Output: None, Baud rate: 19200, and Period (s): empty. Serial D has Input: None, Output: None, Baud rate: 115200, and Period (s): empty. The 'RTS/CTS' checkbox is checked for Serial C and unchecked for the others. There is also an 'Infrared' checkbox for Serial D. At the bottom right are 'Refresh' and 'Apply' buttons. At the bottom left are 'OK', 'Exit', 'Save', and 'Set all parameters to defaults' buttons.

Figure 10: Since we connected the WXT520 to serial port C on the back of the receiver we have set that serial port to communicate with the WXT520 at the same baud rate we set the WXT520 to be. We have also selected the Input to be Echo and the output to be None. Make sure you DO select RTS/CTS.

After you have configured the serial port on the NET-G3 click OK and this will take you back to the original window you started at.

We now need to send some GRIL commands to the NET-G3 to set a few more things on the serial port. From the File dropdown menu select Manual Mode; this will open up a terminal where you can issue GRIL commands to the receiver. We need to enable the wrapped echo mode, using the following command:

```
set, dev/ser/c/ewrap, on
```

Now we set the NET-G3 to listen for the NMEA XDR messages that the WXT520 is sending out every 5 seconds. To do this we send the following command:

```
dm, dev/ser/c, misc/MET3
```

The command above will query the listen for incoming NMEA XDR message. NOTE: We use misc/MET3 because we are disabling the NET-G3 from querying the MET3 and instead setting it to

listen to anything that comes in through the serial port.

Now we can test whether or not the WXT520 and the NET-G3 are communicating. To do this send the following command:

```
set, dev/ser/c/echo, /cur/term
```

The command above will start outputting messages every 5 seconds to the terminal in the following form:

Now you know that the two devices are communicating. At this point you are ready to redirect these messages to the GPS file currently being logged. To do this issue the following command:

```
set, dev/ser/c/echo, /cur/file/a
```

At this point the WXT520 data is being injected into the currently logged GPS file every 5 seconds. You can download the file currently being logged and run the following command to extract the met data:

```
teqc -top tps +met $filename.met $filename > $filename.09o
```

You should see something like the following in the \$filename.met file:

nf2009

Online URL:

<https://kb.unavco.org/article/vaisala-how-to-integrate-the-vaisala-wxt520-with-the-topcon-net-g3-526.html>